



CITY COUNCIL WORK SESSION

March 03, 2026 at 5:00 PM

City Hall Council Chambers – 450 Virginia Avenue, Long Lake, MN 55356

AGENDA

1. Call to Order

2. Approve Agenda

3. Open Correspondence

NOTE: Open Correspondence is an item on the agenda during which the public may address the City Council.

No formal action is taken by the City Council and comments shall be limited to five minutes or less.

Open Correspondence comments may also be emailed to City staff by 12:00 noon on the date of the meeting.

4. Regular Business

A. Discussion of a Request by Xcel Energy to Use Hardin Park for a Project to Update Power Transmission Lines Along the Luce Line Trail

B. Review Sanitary Sewer Televising Results

C. Proposal for Grand Avenue Project Administration



5. Other Business / Work Session Council Reports

6. Adjourn



Figure 1
Sanitary Sewer Districts
2026 Inflow and Infiltration Monitoring
City of Long Lake, MN

- Legend**
- Sanitary Sewer District
 - Manhole
 - Lift Station
 - Gravity Main
 - Forcemain
 - MCES Gravity Main
 - MCES Forcemain
 - City Boundary
 - CIPP Lining

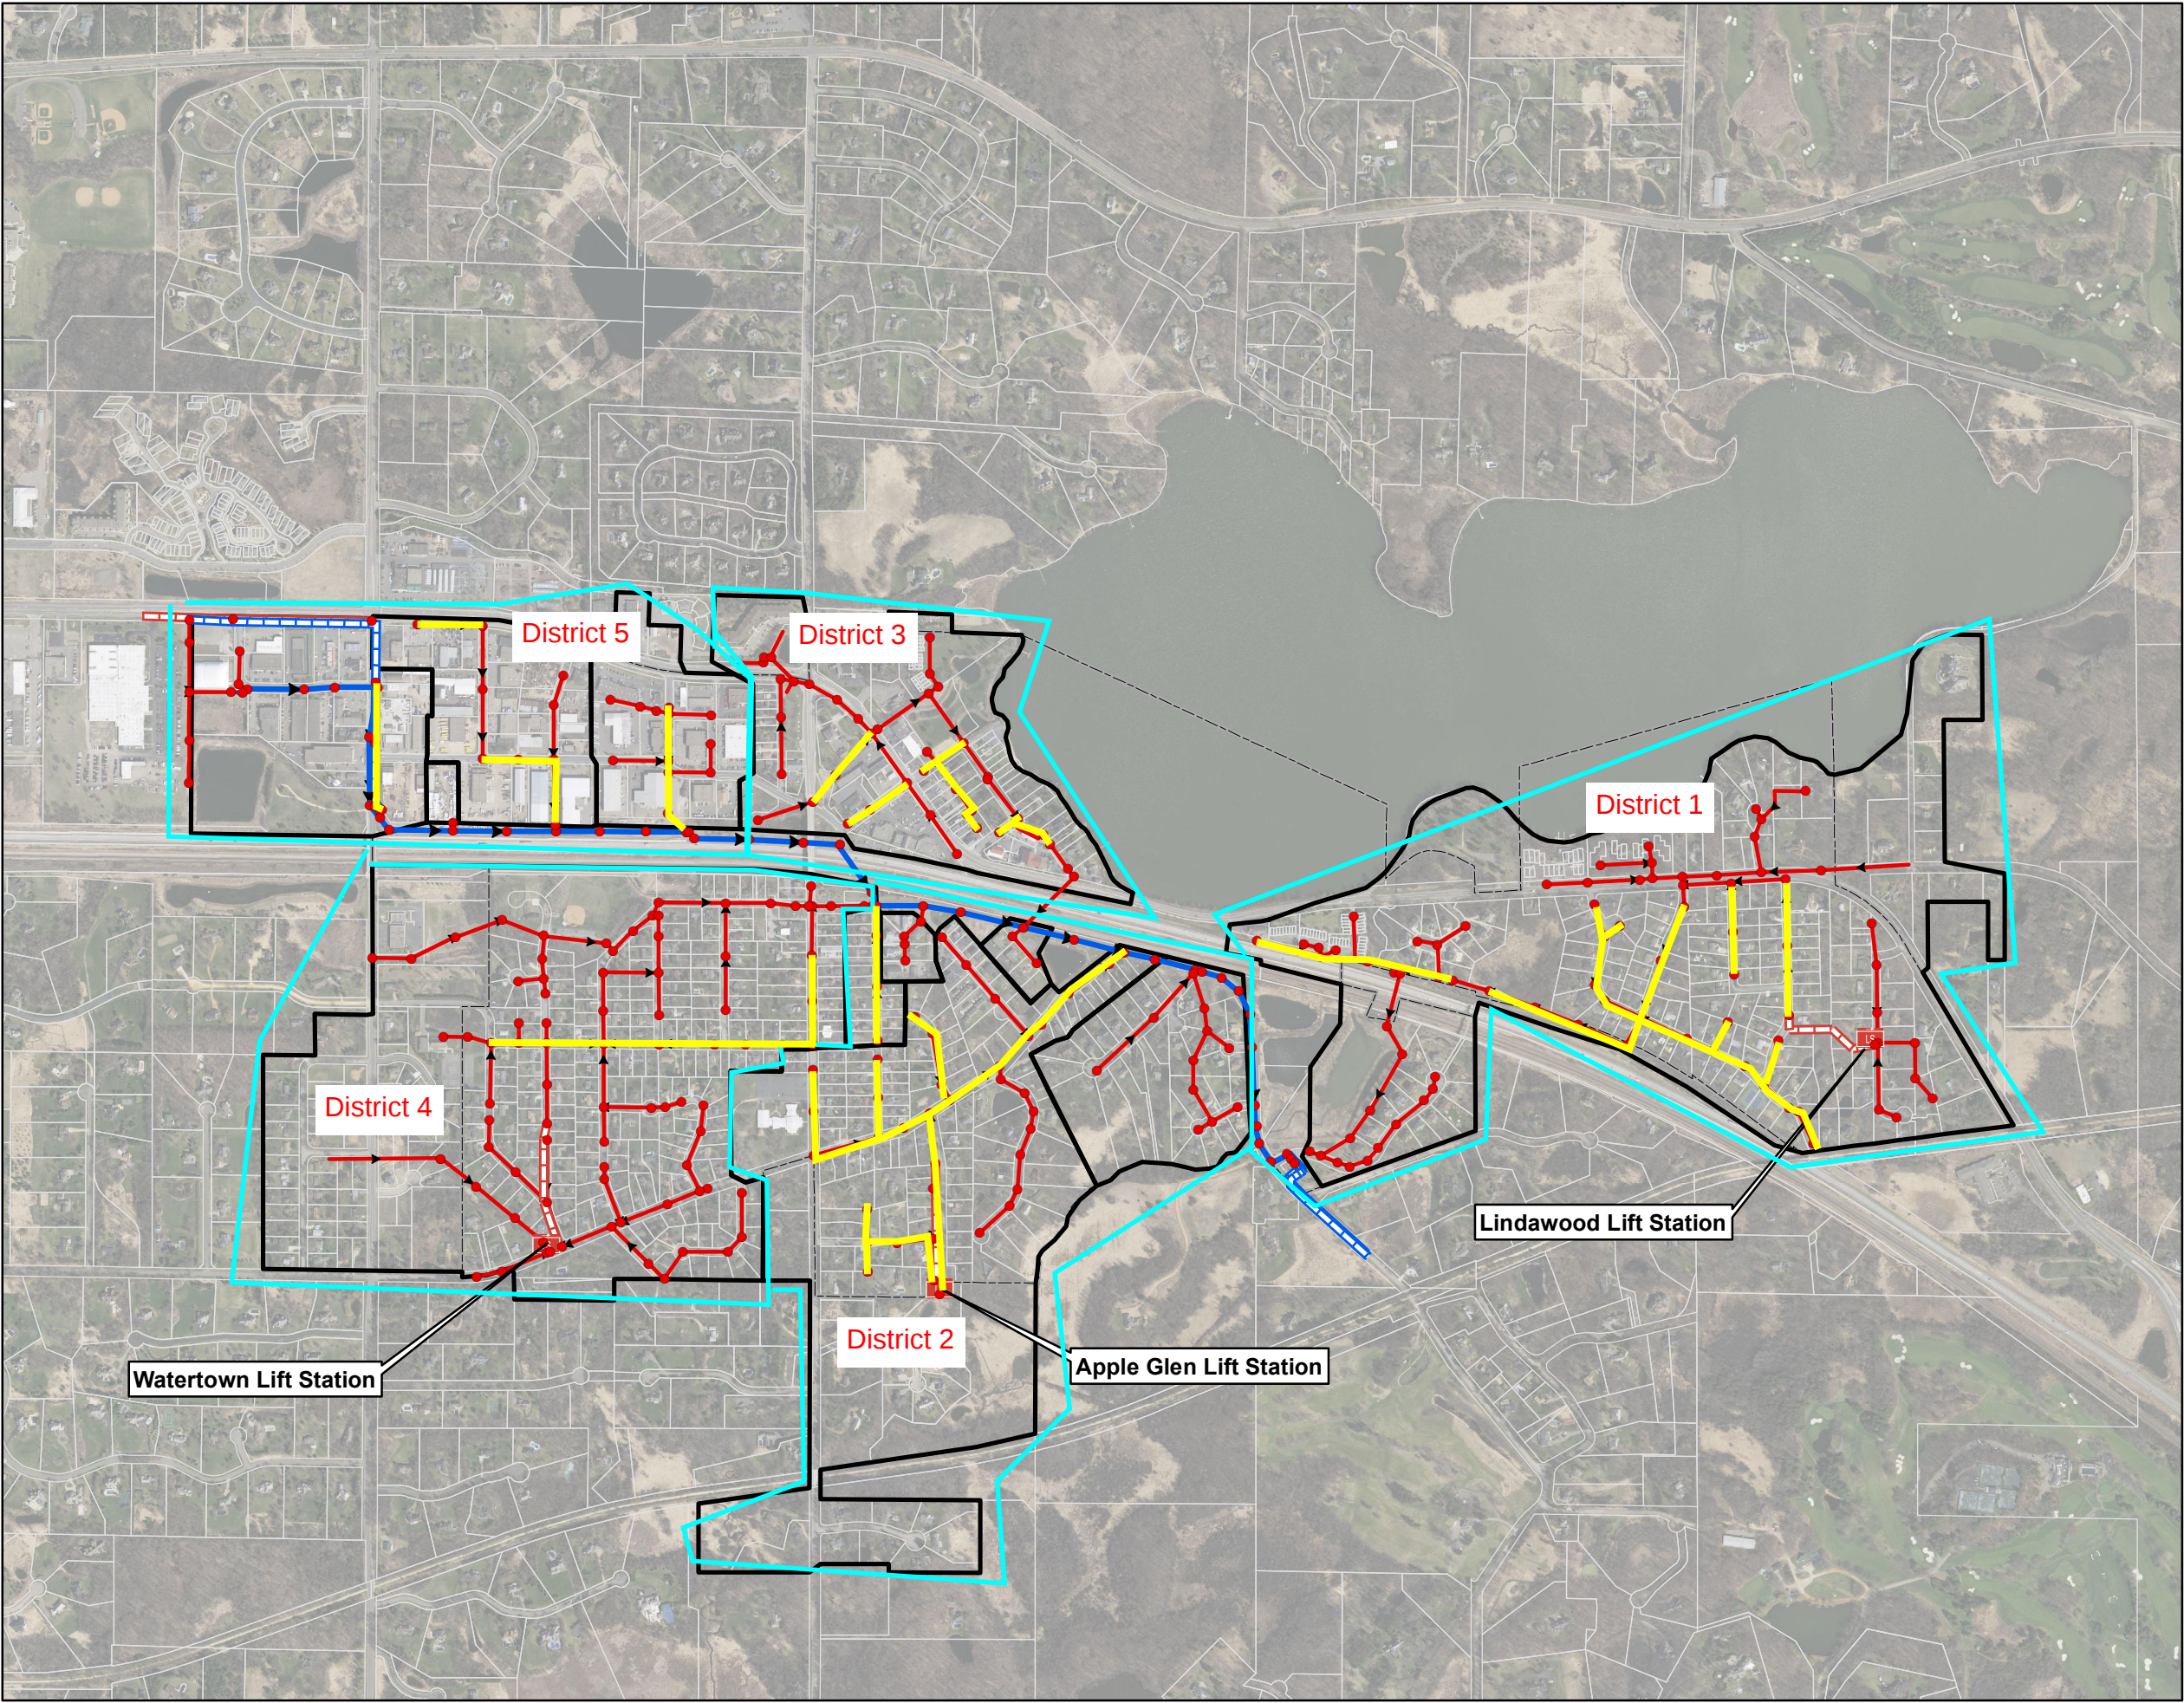

Sanitary
Sewer -
District 1

140 - 139 pictures



2K to 3K: Service 260' dripping leak, service 275' running leak, service 277' 4 running leaks, service 314' running leak, service 315 dripping leak, and service 354' running leak.

2K to 18C2: Infiltration gushing at 18C2 MH and roots growing in pipe

1K to 4-C: Standing Water from 1K to 30' towards 4-C

5-C to 6-C: possible running leak at service 35'

113 to 4-C: 20' multiple cracks, 40% water level sag at 118' Clay Pipe

4-C to 162-S: 20% water

HIGHER WATER LEVELS, CONSISTENT WITH AREA

HIGHER WATER LEVELS, CONSISTENT WITH AREA

MINOR SAG 63' FROM 155S

MINOR SAG 28' FROM 156S


STANDING WATER RIGHT OUTSIDE OF 9C

PRIVATE THREE HOME INJECTION SYSTEM

EAST LONG LAKE ORONO INTERCONNECT

LINE

District 1

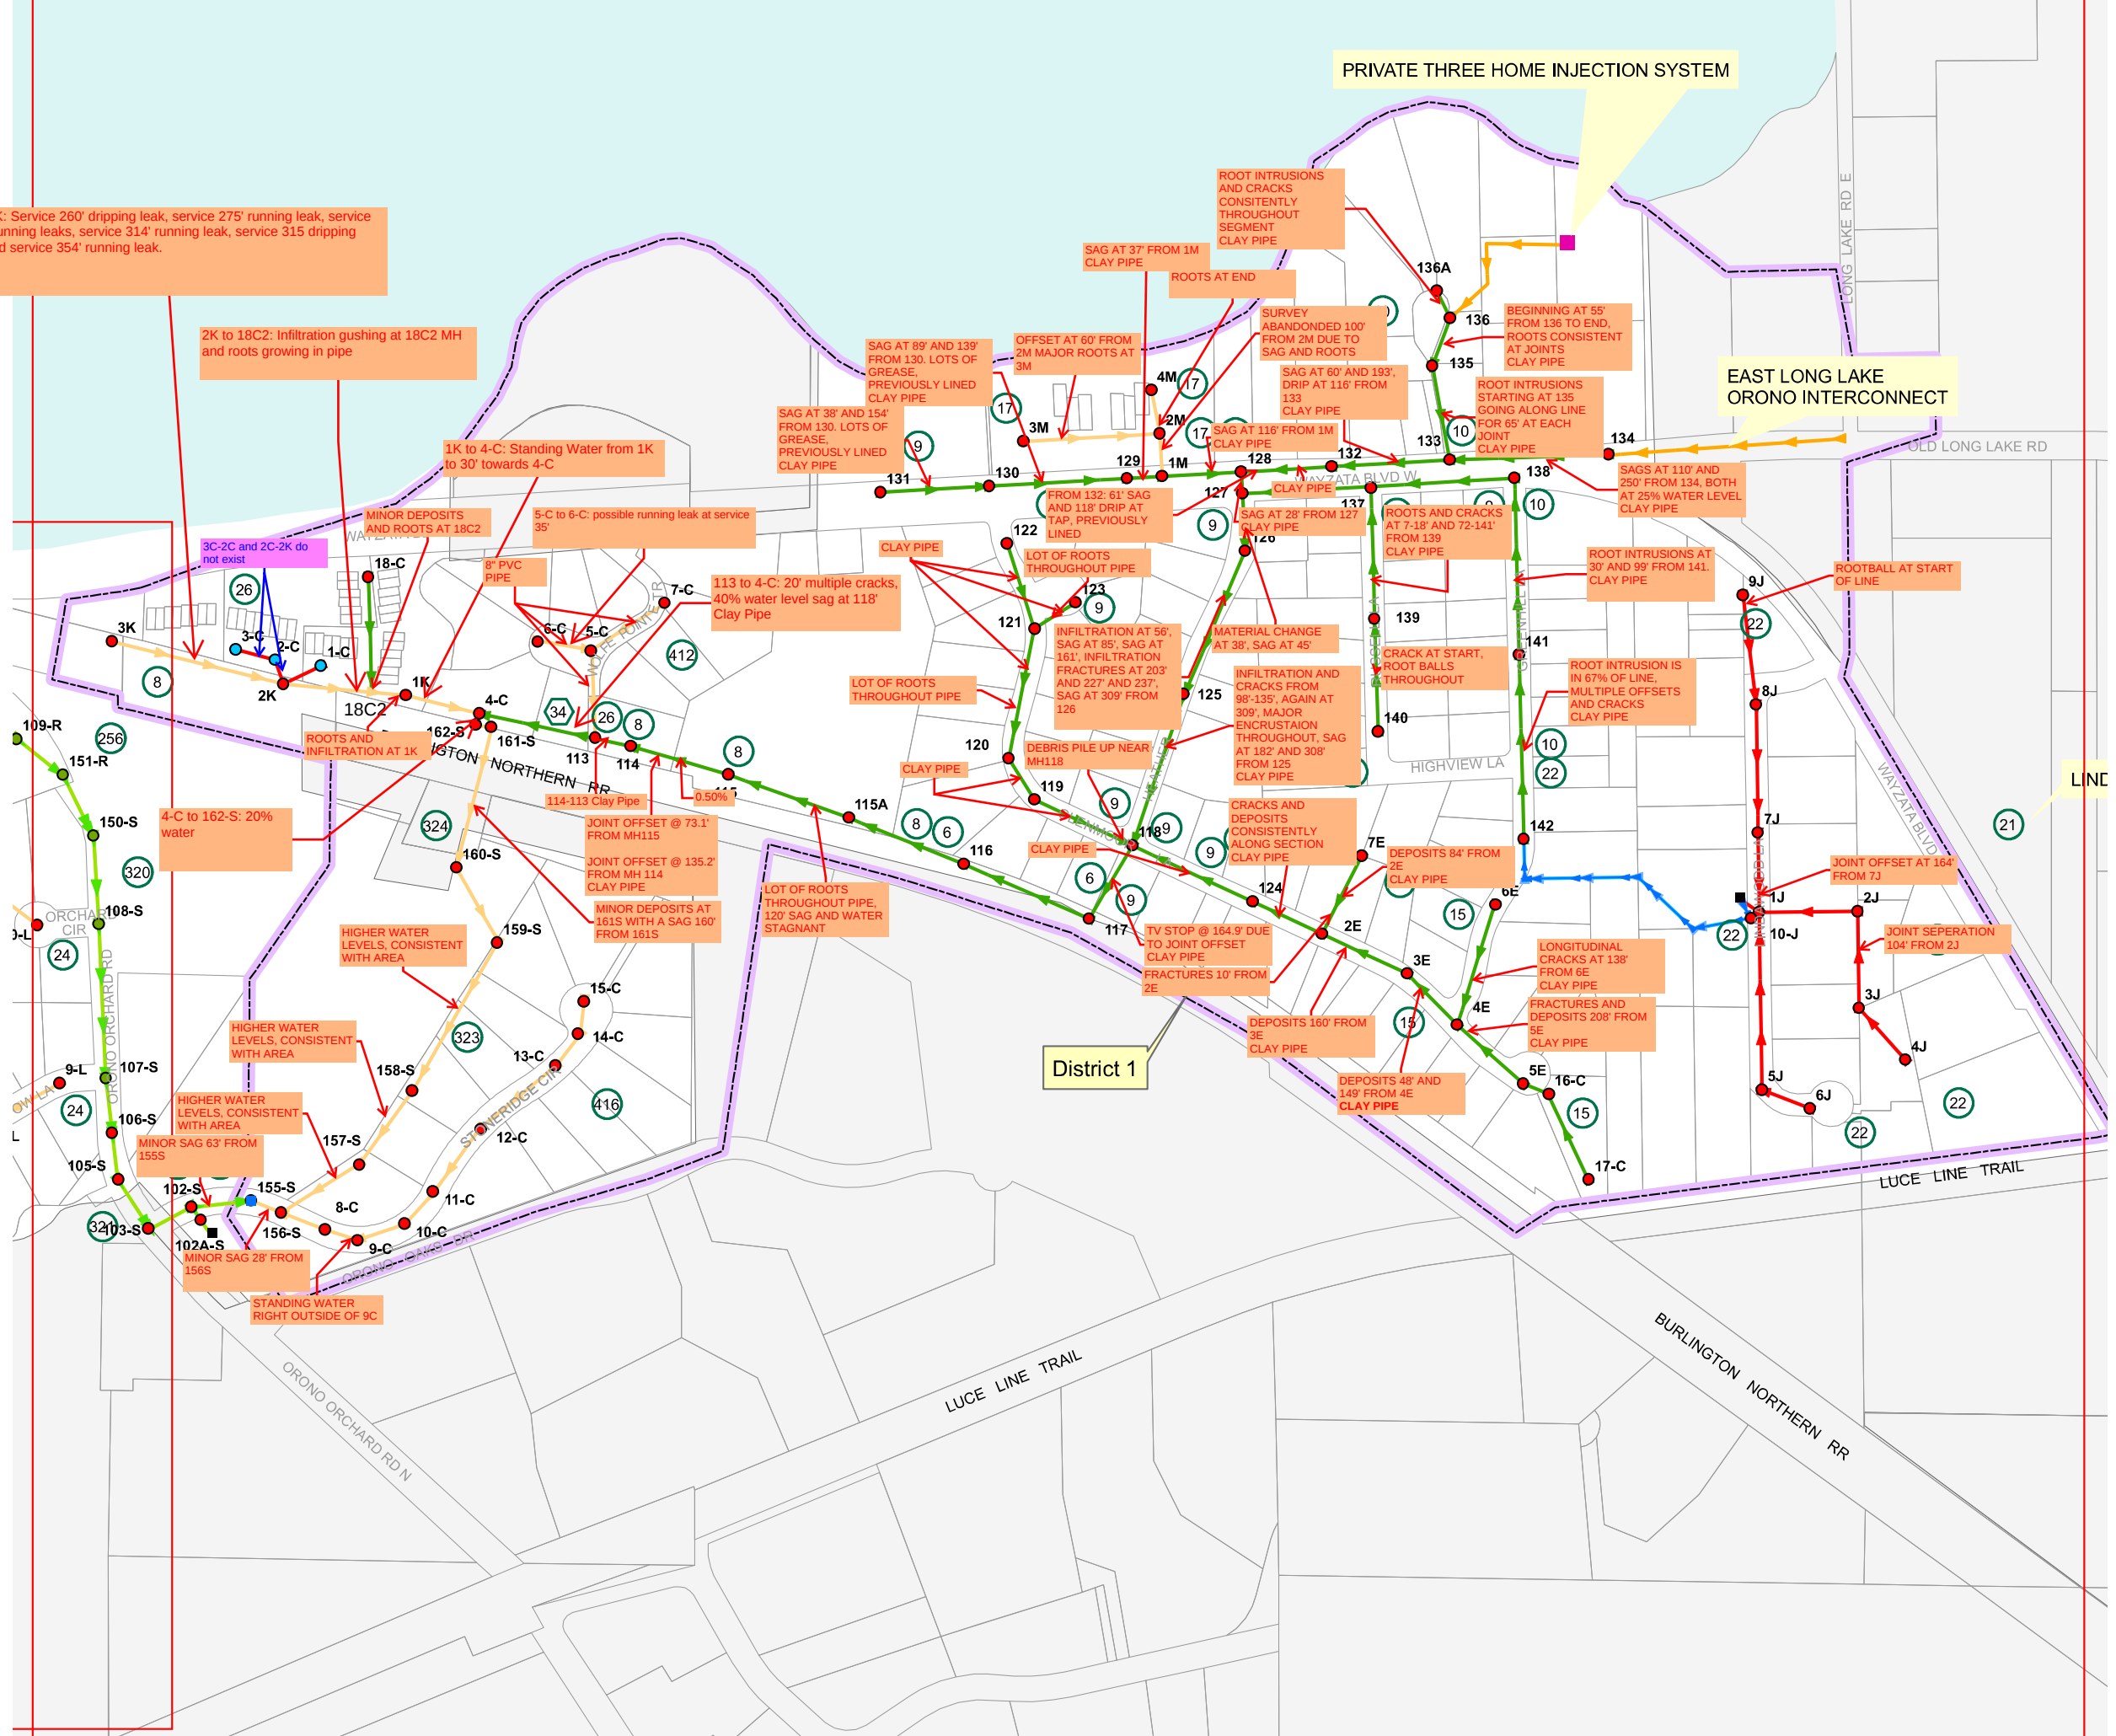

Sanitary Sewer - District 2

UNKNOWN MATERIAL (LINED), 8
DEFECTIVE SERVICES, 1 ROOT

VCP&DIP, 1 ROOT, 2 DEFECTIVE SERVICES

VCP, 1 DEFECTIVE SERVICE

VCP, 9 DEFECTIVE SERVICES
(INFILTRATION IN MULTIPLE SERVICE
CONNECTIONS), 10 ROOTS, 1 CRACK

VCP, 13 ROOTS, 7 DEFECTIVE SERVICES

VCP, 3 DEFECTIVE SERVICES

UNKNOWN MATERIAL (LINED), 3
DEFECTIVE SERVICES

VCP, 5 ROOT, 5 DEFECTIVE SERVICES

VCP, 2 DEFECTIVE SERVICES

VCP, 3 DEFECTIVE SERVICES, 1 ROOT,
1 CRACK

VCP, 2 CRACK, 3 DEFECTIVE SERVICES

VCP, 1 BROKEN, 3 DEFECTIVE
SERVICES, 13 ROOTS

VCP&PVC, 2 DEFECTIVE SERVICES, 1
CRACK, 1 ROOT

VCP, 1 BROKEN, 2 DEFECTIVE SERVICES

VCP, 2 DEFECTIVE SERVICES

VCP, 2 DEFECTIVE SERVICES, 1 CRACK

VCP, 1 DEFECTIVE SERVICE

VCP, 8 ROOT, 2 DEFECTIVE SERVICE

ORONO INTERCONNECT

Section 4B.

District 2

ORONO

BROWN RD N

ONE SINGLE FAMILY HOME SERVICE CONNECTION @ MANHOLE

ORONO 1 SFH INTERCONNECT

3-P

2-P

1-P

28

4

306

276

304

308

89

302

90

91

92

101

102

100

93

99

108

107

143

144

109

95

141-R

140-R

129A-R

129-R

130-R

131-R

132-R

133-R

134-R

135-R

271

270

250

252

253

117-R

116-R

118-R

120-R

26-1

26-2

26-3

26-R

249

201-R

Wayzata Blvd

Burlington Northern RR

District 3

PVC, 1 DEFECTIVE SERVICE (VISIBLE INFILTRATION IN SERVICE)

POLYETHYLENE, 1 DEFECTIVE SADDLE

VCP, 3 DEFECTIVE SERVICES, 1 CRACK

VCP, PVC, & DIP

VCP&PVC, 3 DEFECTIVE SERVICES, 1 CRACK, 1 BROKEN, 1 ROOT

VCP, 10 ROOTS, 3 DEFECTIVE SERVICES, 3 CRACKS

PVC, 3 DEFECTIVE SERVICES

VCP, 5 ROOTS, 2 CRACKS

3 DEFECTIVE SERVICES

VCP; 2 VIDEOS SHOW 133-R1 TO 133-R AND 133-R2 TO 133-R1 (CANNOT FIND 133-R1 OR 133-R2)(BOTH ARE VCP)

VCP&DIP, 2 DEFECTIVE SERVICES, 1 DEFECTIVE SADDLE

VCP&PVC&DIP-2 DEFECTIVE SERVICES, 2 ROOTS, 1 CRACK

VCP&POLYETHYLENE, 10 CRACKS

VCP, 4 DEFECTIVE SERVICES, 2 ROOTS

short liners occasionally throughout the pipe run and pvc replacement towards the end, joint offset

pvc change at point repairs

Section 4B.

